


Car Seat Safety Tip Sheet

- 1. Straps should be at or below baby's shoulder
- 2. Butt should be all the way to the back of the car seat
- 3. Crotch strap should be in the slot closest to baby (if extra slots are available)
- 4. After the harness is tightened, should not be able to pinch any fabric at baby's shoulders
- 5. Chest clip at armpit level
- 6. Harness shouldn't have any twists in it
- 7. Check expiration date
- 8. See if there are any recalls



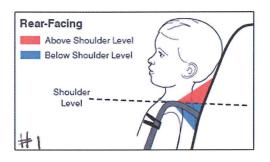

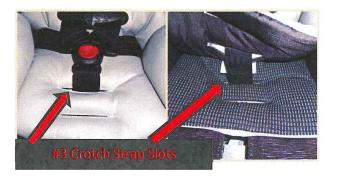

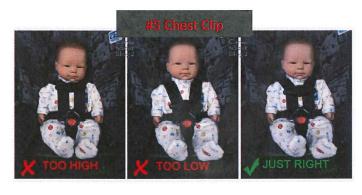



Cro	otch Ro	II/Expirat	tion Cheat Sheet
Manufacturer	Yes	No	Expiration
Baby Trend		х	6 years
Britax		Х	6 years
Chicco		Х	6 years
Combi		х	7 years
Cosco		Х	6-8 years
Cybex	х		6 years
Evenflo	х		6 years
Graco	х		7 years
Maxi-Cosi	х	(2	6-8 years
Peg Perego		X	7 years
Phil&teds Alpha		Х	6 years
Urbini	X		6 years

Authorized Carry Handle Positions for Rear-Facing-Only Seats (Only locked positions are used for vehicle travel)

Manufacturer Model /Authorized Positions for Travel Aprica (retroactive) A30 – Any locked position Aria Child Urbini Petal Touri/Omni Any locked position Baby Trend EZ Flex Loc, EZ Flex Loc 32, Flex Loc, Inertia, Secure Snap Gear 32 – Any locked position; EZ Loc-either position behind and below top edge; Rigid LATCH Loc-either position behind and below top edge Britax B-Safe, B-Safe 35, B-Safe 35 Elite Any locked position Britax Baby Safe Behind top edge of seat Britax Chaperone Any locked position **Britax Companion** Behind seat, at bottom Chicco, all models Any locked position Combi Centre, Navette 22, all Shuttle models Up position only Combi Connection Any locked position Cybex (Regal Lager) Aton, Aton 2, Aton Q – Up position only. Dorel, all models including Cosco, Eddie Bauer, onBoard models- Up position only; Other Maxi-Cosi, Safety 1st models - any locked position Dream on Me Mia Moda Certo Any locked position Evenflo Embrace 35, Nurture, Secure Ride 35, Rebound bar position (close to vehicle seat), Serenade behind top edge or behind seat, locked Evenflo Lite Max 35 Only behind top edge of seat (position 3) Behind top edge or behind seat, locked Evenflo, all models except those listed above Goodbaby Asana 35/AP Any locked position Graco rear-facing-only seats (retroactive) Any locked position. Current models only. Hauck ProSafe 35 Any locked position Only upright "Carry" position. Kiddy USA Evolution Pro Kids II Ingenuity InTrust 35/Pro Only behind top edge of seat Learning Curve Via I450, I470 Rebound bar position (close to vehicle seatback) preferred, behind seat at bottom allowed Learning Curve I400-1420 LP, Via I440 Any locked position behind seat (not straight up) Mia Moda Viva, Viva Supreme Do not use. All recalled. Nuna Pipa Any locked position; no contact with vehicle interior. Soft handles are lowered to top edge of seat. Orbit Infant, Infant G2, Infant G3 Peg Perego Primo Viaggio 4-35 With base: behind top edge of seat. Without base: at child's feet Peg Perego Primo Viaggio (all other models) Behind top edge of seat Phil&Teds Alpha Protect Any locked position Recaro Performance Coupe At child's feet Simple Parenting Doona At child's feet Summer Infant Prodigy Any locked position Team Tex Baby Ride Behind top edge of seat Teutonia T-Tario 32, T-Tario 35 Any locked position (retroactive) UPPAbaby Mesa Any locked position

SafetyBeltSafe U.S.A. P.O. Box 553, Altadena, CA 91003 www.carseat.org 310/222-6860, 800/745-SAFE (English) 310/222-6862, 800/747-SANO (Spanish)

This document was developed by SafetyBeltSafe U.S.A. and may be reproduced in its entirety. Important: Call to check if there is a more recent version before reproducing this document.

Put in Epic



Car Seat Recalls/Defects & Safety Notices - Revised 1/11/2017

This list, covers child car seats manufactured after 12/31/08, was compiled by the Safety Restraint Coalition (425) 828-8975 or 1-800-282-5587. For older seats see separate Archive List (revised yearly). Information may çhange; always call manufacturer to verify. **Most recent addition(s) are shaded.**

This information may not be posted on a website or included in blogs without the express written permission of the Washington State Safety Restraint Coalition 425-828-8975.

4moms

888-614-6667 www.4moms.com

Infant Seat

Self-installing Car Seat Made 7/1/16 - 10/31/16. Problem: Hooks locking carrier to base may stick or fail to attach.Until replaced, double check proper locking into base by pulling up on carrier handle to assure it's secure or install carrier without base. Locate serial number then Visit www.4moms.com/recalls or call: 888-614-6667 for replacement carrier.

Aidia, Inc. (No Recalls)

866-328-8661 www.aidiaproducts.com

Angel Guard (No Recalls)

800-815-6330 www.angel-guard.com

Aprica (No Recalls)

888-569-7288 www.urbinibaby.com

Aria Child (No Recalls)

888-569-7288 www.apricacom

Baby Jogger, LLC

800-241-1848 www.babyjogger.com Infant Seats

City GO Infant seat Models BJ64510, BJ64529; City GO Infant Car Seat Base Models BJ80400, BJ61500; City Mini Car Seat/Stroller System Model BJ72510; Vue Lite Car Seat/Stroller System BJ70411,BJ70424, BJ70431 made 11/3/14 - 4/30/15. Problem: Incorrect/missing information on labels/instruction book may decrease correct use of seat increasing risk of injury.Call: 800-241-1848 for free replacement infant car seat.

Baby Trend

800-328-7363, www.babytrend.com

Harnessed Booster

3-in-One Hybrid LX model FB48417 made 7/14/16 sold only at Wal-Mart & model FB58181 made 7/23/16 sold only at Millitary Exchanges. Problem: In a crash, center adjuster may detach in harnessed mode if child weighs more than 40 pounds. Locate serial number then visit www.babytrend.com or call: 800-328-7363 to determine if your seat requires free replacement.

3-in-One TrendZ Fastback Models FB60070, FB60408 made 10/11 - 7/13. Problem: Buckle may become difficult to unlatch or become stuck in latched position. Call: 800-328-7363 for new buckle. Effectiveness of buckle to restrain child is NOT affected.

Bergeron (No Recalls)

800-371-2778 www.adaptivemall.com

Britax

888-427-4829 www.britaxusa.com

Infant Seats

B-Safe 35 Model EXLU65M and models beginning "E9L" U65M, U65P, U63F, U66R, S63F. B-Safe 35 Elite Models beginning "E9L5" 55T, 56P, 55U, 66C, 65U & B-Safe Travel Systems Models beginning "S91" 4900, 5400, 5200, and S921900, S01635200. Made 10/1/14 - 7/1/15. Problem: Car seat carry handle may crack/fracture while carrying it, causing risk of injury to child. Do not carry by handle until fixed. Recall does not affect seat when used in vehicle or on stroller. Go to www.bsafe35recall.com to order remedy kit and watch video or Call: 800-683-2045.

Chaperone Problem #1: Models begin "E9L692" J, K, L, & M made 9/1/10 -4/30/11. Harness adjuster may detach from the shell. Should it detatch the harness straps will not properly secure the child resulting in increased risk of injury in a crash. IF the harness adjuster on your Chaperone Infant Car Seat detaches, discontinue use of the product immediately and contact Britax. Call: 888-427-4829 for a remedy kit including a harness adjuster clip & instructions for properly installing it. Problem #2: Models begin "E9L69" N9, P2, P3, & P5 made 4/09 - 5/10. Chest clip is brittle & may break causing sharp edges/choking hazard. Call: 888-427-4829 for instructions & new chest clip. If chest clip is broken, remove chest clip & any fragments. Contiue to use seat until replacement chest clip is installed.

Convertible Seats

Advocate 70-G3, Boulevard 70-G3 and Pavillion 70-G3. Models begin "E9L" J91A, E91M, J91S, J92E, J93P, J93S, K91A, K31A, K31Q, K32D, K32Z, K33Q, L11A, L11Q, L12D, L12Z, G81A, G83N, G83P, G83X, G83Y, L21A, L23P, L23Y made 6/1/12 - 8/31/12. Problem: Child chewing on HUGS chest pad may bite off small piece, presenting choking hazard. Call: 888-427-4829 for new HUGS chest pads. New HUGS pads are marked "PP" under harness webbing.

Advocate ClickTight Models E9LT86F, E1A135Q, E9LT86G, E9LT85Q, E9LT86A, E9LT86H, E9LT85S, E1A015Q, E1A016A, and E1A016H. Made 8/1/14 -7/29/15. Problem: Harness adjuster button (red) may remain down in release position and prevent harness from locking. Continue using seat if harness button does not stick and harness remains tensioned. All registered owners will receive a repair kit automatically. Go to www.BritaxClickTight-ConvertibleRecall.com to have a rememdy kit mailed or Call: 1-888-427-4829, Option 3. Boulevard ClickTight Models be-

ginning "E1A" 013Q, 016A, 016H,135Q, LT85Q, and beginning "E9LT" 85Q, 85S, 86A, 86F, 86G, 86H made 8/1/14 - 7/29/15. Problem: Harness adjuster button (red) may remain down in release position and prevent harness from locking. Continue using seat if harness button does not stick and harness remains tensioned. All registered owners will receive a repair kit automatically. Go to www.BritaxClickTightConvertibleRecall. com to have a rememdy kit mailed or Call: 1-888-427-4829, Option 3.

Marathon ClickTight models E1A116L, E9LT76P, E9LT71Q, E9LT76N, E9LT76B, E9LT75R, E9LT76L, E1A006B, E1A005R and EXA116L made 8/1/14 - 7/29/15. Problem: Harness adjuster button (red) may remain down in release position and prevent harness from locking. Continue using seat if harness button does not stick and harness remains tensioned. All registered owners will receive a repair kit automatically. Go to www.BritaxClickTightConvertibleRecall. com to have a rememdy kit mailed or Call: 1-888-427-4829, Option 3.

BubbleBum (No Recalls)

800-969-6586, www.bubblebum.us

CARES (No Recalls)

800-299-6249 www.kidsflysafe.com

Chicco

(No Recalls on seats less than 10 years old) 877-424-4226 www.chiccousa.com

CLEK Inc. (No Recalls) 866-656-2462 www.clekinc.com

Columbia Medical (No Recalls) 800-454-6612 www.columbiamedical.co

Combi USA, Inc.

800-992-6624 www.combiusa.com

Convertible Seats

Problem 1: Coccoro Model 8220 made 1/1/09-7/31/16. When installed forward facing and secured with vehicle LAP-ONLY belt, excessive force may be transferred to the car seat occupant in a crash increasing their risk of injury. (Recall does not affect use of seat when installed in rear-facing position, or if installed forward-facing with lap/ shoulder belt and lock-off or lower anchors and tether.) Call: 888-232-3294 or visit http://registration.combiusa.com/recall for free

Remedy Kit with new bottom cover. **Problem #2:**

- Coccoro Model 818220 made 1/1/09 -12/31/12
- **Zeus Turn** Model 8815 made 7/15/07 3/31/09
- Zeus 360 made 2/1/09 5/31/12. Embedded plastic button prevents harness from meeting minimum breaking strength tolerance when tested independently from child restraint. Could affect overall performance of child restraint in event of crash. Call: 844-697-1690 for Remedy Kit with new straps or visit http://www.combiusa.com/Safety-Notifications/Recall-Information. aspx to register and recieve Remedy Kit. Combi encourages use of seat until kit is received and installed.

Compass (See Tomy)

Convaid (No Recalls)

888-266-8243 www.convaid.com

COSCO (See Dorel)

Cybex

800-593-5522 www.regallager.com

Booster Seats

Cybex Solution X-fix Models 0500200 & 0500760 made 2/1/10 - 2/28/10. Problem: Seats are labeled with incorrect warning related to securing an unoccupied booster. Increases risk of unoccupied booster striking vehicle occupants causing injury in a severe crash. Call: 800-593-5522 or visit www.regallager.com/recall for a new warning label and Owner's Manual. Safety of the seat when used with a properly secured child is not affected. If the seat is unoccupied, ensure it is belted into the vehicle with the vehicle seat belt even when using the LATCH connectors.

Diono (No Recalls) 888-366-7909 www.diono.com

Dorel Juvenile Group (Cosco, Eddie Bauer, Safety 1st, Maxi Cosi, Quinny) 800-544-1108 www.djgusa.com

Infant Seats

All Infant Seats sold as part of a stroller system under Safety 1st, Cosco, Disney, or Eddie Bauer. Made 1/6/08 - 4/6/09. Models, beginning "22-" were sold under the following names and numbers:

 Safety 1st Sojurn: 057 DBY, 085 DWA, 057 CLN, 057 HRT, 322 HRR, 322 PTK, 057 LPH, & 085 LYN.

- Safety 1st Eurostar: 322 KDL, 322 LXI, 322 OLY, 322 PRS, 322 MAI, & 325 COB.
- Safety 1st Explorer: 095 RBK.
- Safety 1st Lite Wave: 380 LGA & 380 MSA.
- Safety 1st Vector: 627 WAV & 325 PAC.
- Cosco Sprint: 300 FZN, 300 OSF, 300 CSF, 300 JJV, 300 THD, & 300
- Disney Propack: 627 AWF, 355 LBF, 305 NAB, 305 PPH, & 355 PWK.
- Eddie Bauer Adventurer: 627 CGT, 627 FRK, 627 SNW & 627 WPR.
- Eddie Bauer Endeavor: 627 KGS & 655 BYTE.

Problem: Handle releases suddenly when carried. Seat may flip & child may fall. Call: 866-762-3316 or visit www. digusa.com to order handle repair kit. Until installed, do not use handle to

Comfy Carry Model IC123 FSM made 5/1/11 - 4/25/12. Problem: Some seats were sold without lower LATCH attachment strap. Call: 877-416-8111 for replacement base with LATCH. Until new base is received consumers should use the seat installed with a seat helt.

Maxi-Cosi Mico Models beginnig "22-" 371CIP, 371CTR, 371FSB, 371LYP, 371MJR, 371PHT, 371RFR, 371TRL, & 372TTH made 5/1/08 - 4/30/09. Problem: Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. Call: 866-623-3139 or email consumer@djgusa.com for repair kit.

OnBoard Models beginning "22-" 077FSM, 078DMS, 346VAL, 356NTR, 356PRO, 356TRI, 657FRK, 657MTT, 657PST, 657SNW, 657SON, & 657VND also model IC-072SON made 5/1/08 - 4/30/09. Problem: Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. Call: 866-623-3139 or email consumer@ djgusa.com for repair kit.

OnBoard 35 Model IC124 FSM made 5/1/11 - 4/25/12. **Problem:** Some seats were sold without lower LATCH attachment strap, Call: 877-416-8111 for replacement base with LATCH, Until new base is received consumers should use the seat installed with a seat belt.

Convertible Seats

Safety 1st Complete Air LX Models CC050AJH, CC050ANY, CC050ANZ, CC050AOQ and Safety1st Complete Air SE Models CC051AIR made 7/20/10 - 5/18/11. **Problem:** Arrows for rear facing belt path installation may appear to point to forward facing belt path. If not installed properly, child may be injured in a crash. Call: 877-675-2355 or email rfbaselabel@djgusa.com for free new labels

and installation instructions.

Safety 1 st Alpha Omega Elite Models 22187ANL 22187REM, 22187REMA, 22187SAR, 22187SARA, 22465FSM, CC033BMT, CC043ANK, CC043ANL, CC043AQS made 7/20/10 - 5/18/11. Problem: Arrows for rear facing belt path installation may appear to point to forward facing belt path. If not installed properly, child may be injured in a crash, Call: 877-675-2355 or email rfbaselabel@djgusa.com for free new labels and installation instructions. Alpha Omega, Alpha Omega

Elite, Enspira, Maxi-Cosi Priori, Prospect, & Vantage Models begin "22-" 148RDH, 149PAL, 150BNS, 152BVL, 152CMN, 152RGS, 154HTR, 155BDF, 155HMR, 155NSHE, 155OTC, 155TRP, 158BLL, 158GRS, 158SPA, 159SGT, 172BKE, 172BRT, 172OKW, 172PHO, 172SVT, 177SNP, 177SNP2, 178SCT, 178STL, 178VSS, 185BVL2, 188BVL2, 195SVS, 195SVS2, 412, 439ABY3, 439HTP3, 4390KP3, 439VNS3, 449GES, 452RBYE, 453BCT, 453FSM, 456BVL, 456CAB, 456CAO, 456CSR, 456LMT, 456MIL 456MRR, 456NTM, 456NTR, 456PRO, 456SCY, 456SUZ, 456TRI, 456TTN, 458FTM, 458NYC, 459MTG, 462BLN, 465BMT, 469BSE, 469BSEC, 475BVL, 476CIP, 476CTR, 476FSB, 476GIP, 476ISP, 476NOW, 476NRF, 476PHT, 476PMK, 476PNG, 486CRI, 486GIP, 486TTH, 546BSE, 547CHA, 553BVL3, 554PCR, 554PCR3, 554RCR3, 561WAL, 564ARZ, 564MIL, 564NTR, 564OKW, 564PHO, 564PRO, 564TRI, 564VLC, 567GRH, 574PCR3, 580BYR, 740HPN, 741ATI, 741BWD, 741GRT, 741, 755BLD, 758BYT, 758CMP, 758FRK, 758HDS, 758HID, 758KGS, 758PST, 758SNW, 758SON, 758VND, 759MTT, 790CGT, 790SNW, 790WPR, 790WPR2, 799MER, 880BYT, 880MTT, 880MTTA, 880SON, 880SONA, & 560FSM also models 93-560FSM, 17-439ABY, & 17-439HTP made 5/1/08 - 4/30/09. **Problem:** Harness may gradually loosen during normal use increasing risk of injury in crash. Until repaired double check to assure harness is adjusted snugly around child. Call: 866-623-3139 or email consumer@ digusa.com for repair kit.

Eddie Bauer Deluxe 3 in 1 convertible Models beginning 22790CGT, CC046AAI, CC046AAU, CC046CTA, CC046SNW, CC046WPR made 7/20/10 - 5/18/11. Problem: Arrows for rear facing belt path installation may appear to point to forward facing belt path. If not installed properly, child may be injured in a crash. Call: 877-675-2355 or email rfbaselabel@djgusa.com for free new labels and installation instructions.

Downunder (No Recalls)

Dream On Me (No Recalls)

732-748-1300 www.dreamonme.com

...........

EddieBauer (See Dorel)

Evenflo

800-233-5921 www.evenflo.com

Infant Seats

Embrace35 Models 30711365, 31511040, 31511323, 31511400, 3151198, 3151953, 31521138, 46811205, 46811237, 48111200, 48111215, 48111215A. 48111218, 48111234, 48111235, 48111235A, 48111462, 48411391, 48411391D, 48411392, 48411504, 48411504d, 52911307A, 52921040, 55311138, 55311238, and 55311292 made 12/1/11 - 5/31/13. Problem: Harness buckle may become stuck in latched position making it difficult to remove child. Order new buckle at www.buckle.evenflo.com or Call: 800-490-7591

First Choice Model 3604098 made 1/16/09 - 9/29/09. Problem: Mandatory information may be missing from product labels. Call. 800-233-5921 for replacement labels.

Convertible Seats

Buckle Recall on these models:

- Momentum 65 (LX and DLX) Models beginning "385" made 3/4/13 - 8/26/13.
- Sure Ride DLX Models beginning with "371" made 6/20/12 - 10/17/13.
- Titan 65 Models beginning "371" made 6/20/12 - 10/17/13. Problem: Harness buckle may become stuck in latched position making it difficult to remove child. Order new buckle at www.buckle.evenflo.com or Call: 800-490-7591

Harnessed Booster/All-in-1 Buckle Recall on these models:

- Chase, Chase LX & Chase Select Models beginning "306" made 8/23/11 - 3/3/14
- Chase LX and DLX Models beginning "329" made 8/23/11-3/3/14.
- Secure Kid (LX, DLX, 100, 300, and 400 models) beginning "308" made 12/13/11 - 3/3/14.
- Symphony 65, 65E3 (LX and DLX) Models beginning "345" or **"346"** made 10/2/12-8/26/13.
- Maestro and Maestro Perfomance models beginning "310" made 8/22/11 - 10/17/13 have buckle recall (below) and Maestro Model numbers beginning "310" made 11/24/09 - 4/9/10 have Problem #2: In a crash, crack may form at front of seat causing child not be be properly restrained. Call: 800-233-5921 for reinforcement kit. Children weighing less than 40 lbs. should use another seat until repaired; those weighing more than 40 lbs. may continue use only as a booster until repaired.

Problem: Harness buckle may become stuck in latched position making it difficult to remove child. Order new buckle at www.buckle.evenflo.com or Call: 800-490-7591

Evolve 3-in-1 Combination Booster Models 34411700 and 344117421 made before 2/9/16 when used with harness. Problem: Child may reach button and loosen harness. IF child loosens harness stop using seat until remedy kit is installed. Order remedy kit at www. evolve.evenflo.com or Call: 800-233-

Transitions 3-in-1 Combination Booster Models 34411686, 34411695, and 34411029, made 12/18/14 - 1/29/16 when used with harness. Problem: Child may reach button loosening harness and increasing risk of injury in crash. Order remedy kit at www.transitions. evenflo.com or Call: 800-233-5921

Booster Seats

Big Kid Model 30911173AD. 3091967AD, 30911118AD & 30911120D. Problem: Small number of seats intended for display were incorrectly shipped to institutional customers. Seats were shipped between 8/6/12 - 9/18/12 and meet all crashworthiness standards. Affected units have a label stating: "Display Only, Not intended for sale" on back of headrest. Call: 800-233-5921 for instruction manual, registration card & label.

Exo Motion (See Recaro)

E-Z-On Products (No Recalls)

800-323-6598, www.ezonpro.com

First Years (See Tomy)

Fisher Price (See Britax)

GoBooster (No Recalls)

888-327-4336 http://gobooster.com

Goodbaby USA (No Recalls)

844-543-2020 www.gbchildusa.com

800-345-4109, www.gracobaby.com Infant Seats

Graco Buckle Recall on:

Graco

- SnugRide & SnugRide Classic Connect made 3/1/11 -5/31/13
- SnugRide 30 & SnugRide Classic Connect 30 made 7/1/10 - 1/31/13;
- SnuaRide 35 & SnuaRide Classic Connect 35 made 5/1/11 - 1/31/13
- **SnugRide Click Connect 40** made 6/1/12 - 12/31/12
- Aprica A30 made 7/1/11 -4/30/12.

Problem: Some harness buckles can become stuck in latched position. Effectiveness of buckle to restrain child is NOT affected. Order replacement

buckle online

www.GracoBuckleRecall.com or Call: 877-766-7470.

Convertible Seats

Buckle Recall on these models

- Classic Ride 50 made 10/1/11 - 9/30/13:
- Cozy Cline, Toddler SafeSeat-Step 2 made 1/1/06 - 4/30/10.
- My Ride 65, My Ride 65 with Safety Surround made 4/1/09 - 7/31/13 (and 9/30/13 as some seats made after the end date of production were made with the old buckles).
- My Ride 70 made 5/1/12 -7/31/13.
- My Size 70, Size4Me 70, Headwise 70, Headwise 70 withSafety Surround made 1/1/12 - 7/31/13 (and 8/3/13 as some made after the end date of production were made with the old buckles).
- Ready Ride 70 made 10/01/10 - 9/30/13.
- Smart Seat, Smart Seat with Safety Surround made 12/1/10 - 9/30/13 and 10/9/13, 12/25/13, 1/10/14 (some made after the end date of production were made with the old buckles).

Problem: Some harness buckles can become stuck in latched position. Effectiveness of buckle to restrain child is NOT affected. Order replacement buckle online www. GracoBuckleRecall.com or Call: 877-766-7470.

Classic Ride model 1812930 made 3/1/14 - 2/28/15. Problem: Label missing information on locating instructions. Order replacement label https://pages.email.gracobaby.com/2016LabelRecall/or Call: 800-345-4109.

Comfort Sport models 1794333, 1813040 made 3/1/14 - 2/28/15. Problem: Label is missing information on location of instruction book. Order free replacement label at https://pages.email.gracobaby.com/2016LabelRecall/ or Call: 800-345-4109.

Extend2Fit Model 1954477 made 11/27/15 - 1/20/16. Problem: Recline label affixed to wrong location may result in infant too upright or toddler too reclined. Assure all labels including recline label identifying recline postions 1-6 on each side of seat are not in same language. Call: 800-345-4109 for new label.

Ready Ride Models 1924519, 1923520 made 3/1/14 - 2/28/15. Problem: Label missing information on instruction book location. Call: 800-345-4109.

All-in-1

Milestone Models 1910130, 1923980, 1926538, 1926539 made 7/9/15 - 10/9/15. Problem: Labels do not have

required wording about how to install seat with LATCH or seat belt per FMVSS 213. Recall does not affect safety performance. Registered owners will be sent a new label or **Call**: 800-345-4109.

Combination Seats

Buckle Recall on these models:

- Argos 70 and Argos 70 Elite made 5/1/11-7/31/13.
- Nautilus 3-in-1, Nautilus Elite, Nautilus Plus, made 10/1/27-7/31/13 (and 8/19/13 as some seats were made using recalled buckles).

Problem: Harness buckle can become stuck in latched position. Effectiveness of buckle to restrain child is NOT affected. Order replacement buckle using Graco's online order form at GracoBuckleRecall.com or Call: 877-766-7470.

Booster Seats

- Turbo booster seat models: 1963973 made 3/8/16-4/2/16
- 1963974 made 12/22/15-3/30/16
- 1963975 made 12/22/15-3/17/16
- 1963976 made 2/17/16-3/24/16
- 1967886 made 1/13/16-4/5/16
- 1975173 made 3/29/16

Problem: Owner's manual omits instruction to prevent seat from becoming projectile by buckling it when not in use. Seat is still effective to restrain child. Verify your booster is affected then download the information online at https://pages.emailgracobaby.com/2016TurboBoosterRecall/ or Call: 800-345-4109 for missing instructions.

Harmony (No Recalls) 877-306-1001 www.harmonyjuvenile.com

hauk Fun for Kids (No Recalls) 905455-5888

Immi (See Safe Guard)

JJ Cole (See Tomy)

Jané (No Recalls)

415-824-12371 www.jane.com

Jeffco Fibres (No Recalls)

508-673-1001 www.jeffcofibres.com

Jupiter Industries (No Recalls) 800-465-6795 www.jupiterindustries.com

Kiddy

678-377-3309 www.kiddyusa.com

7-3309 WWW.Riddydsa.com

Combination Seats
World Plus Combination seat model
51-100WP made 2/1/12 - 10/5/13 (all
models ever produced). Problem: Buckle
tongue on shield may not fully engage leaving
child unrestrained. Affects seat only when
used with shield (not as booster). Call: Kiddy
Customer Service 855-925-4339 to arrange
return of seat and reimbursement of full
purchase price.

Kids Embrace (No Recalls) 866-947-3287 www.kidsembrace.com

Lamaze (See Tomy)

LaRoche Brothers (No

.,.,.,.,.,.,.,.,...................

Recalls)

(See Jeffco Fibres)

Learning Curve (See Tomy)

Lenox Juvenile Group (No Recalls) (Out of business)

Lil Fan (No Recalls)

317-804-9160 www.lilfan.com

Little Tikes (No Recalls)

800-321-0183 www.littletikes.com

Maxi-Cosi (See Dorel)

Merritt Manufacturing

317-409-0148 www.eztether.com

Mia Moda, Inc.

866-642-6632 www.miamodainc.com

Infant Seats

Mia Moda Viva and Viva Supreme Model 5000, 5001, 5050, 5051, 5070, 5071, 5080, & 5081. Problem: Harness splitter plate on rear of seat has sharp edges & may cut harness or base may crack in crash. In crash child would not be properly restrained. Call: 877-546-8437 Immediately stop using the seat. Manufacturer will offer refund.

Nania (See Team-Tex)

Nuna (No Recalls)

855-686-2872 www.nuna.eu/USA/index

Orbit Baby

877-672-2229, www.orbitbaby.com

Infant Seat

Orbit Baby Car Seat Bases Problem: G2 Bases model ORB822000 with Batch #A0840, A0860 or A0880 made 3/20/13 - 7/20/13. StrongArm knob may detach or spin without tightening base preventing proper installation. Register seat at Orbit website, then Call: 877-672-2220 for StrongArm knob repair kit. If seat is not tightly secured then install without base until repaired.

Peg Perego (No Recalls) 800-671-1701 www.pegperego.com

Phil & Teds (No Recalls)

800-839-4985 www.philandteds.com

Porsche (Contact Britax)

Recaro

888-973-2276 www.recaro.com

Convertible Seats

Como all models made 11/1/07 - 2/16/09. Problem: Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. Inspect seat: Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat. Call: 888-473-2290 for replacement. If harness straps stay tight continue using seat

ProRide All models beginning with 332.01 made 4/9/10 - 6/9/15 Problem: Tether may detach from car seat during crash increading risk of injury to child/other occupants. Email recarorecall@m-s-s.com or Call: 866-628-

PerformanceRide All models beginning with 333.01 made 1/15/13-6/9/15. Problem: Tether may detach from car seat during crash increading risk of injury to child or other occupants. Call: 866-628-4750 or email recarorecall@m-s-s.com.

Signo Problem: All models made 11/1/07 - 2/16/09. Problem: Harness may not tighten/lock properly. In crash child may not be securely restrained & sustain injury. Inspect-seat: Take empty seat & pull on harness adjuster strap to fully tighten harness. Next, pull on both shoulder straps without lifting/pressing harness release lever. If straps loosen, immediately stop using seat. Call: 888-473-2290 for replacement. If harness straps stay tight continue using seat.

Regal Lager (See Cybex)

Safe Traffic System

(No Recalls) 847-233-0365 www.safetrafficsystem.com

SafeGuard (No Recalls)

800-586-7839 www.safeguardseat.com

Safeline Kids (See Tripleplay)

Safety Angel/Safe Start

(No Recalls)

561-732-1233 www.safetyangel.com

Safety Baby (see Team Tex)

Safety 1st (see Dorel)

Sammons Preston (No Recalls) 800-323-5547

www.sammonspreston.com

Simple Parenting (No Recalls)

862-240-1755

www.happykidss martparents.com

Snugli

800-374-3603 www.snugli.com as

Booster Seats

Snugli Booster models beginning "308" made 12/13/11 - 3/3/14. Problem: Harness buckle may become stuck in latched position making it difficult to remove child. Order replacement buckle on- line www.buckle. evenflo.com or call: 800-490-7591

Summer Infant (No Recalls)

800-268-6237 www.summerinfant.com

Sunshine Kids (See Diono)

Teutonia USA (No Recalls)

877-838-8664, www.teutoniausa.com

Tomy International

800-704-8697 www.tomy.com

Infant Seat

Learning Curve models 1420 (with fabric codes ARD, FUO and MAR) made 5/7/06 - 5/15/06. Problem: Shell may crack in crash if metal slide on end of crotch strap is not installed correctly. Assure metal slides lie flat against shell in correct location. Call: 800-704-8697 for assistance.

Uppababy (No Recalls)

781-413-3000 www.uppababy.com

Urbini (See Aria Child)

Volvo (No Recalis)

800-458-1552 www.volvocars.com